AUTHENTIC PERFORMANCE™

MOPAR®

ELIMINATE A/C ODOR WITH

MOPAR® COOLING COIL CLEANER & COATING

DODGE CHRYSLER Jeep

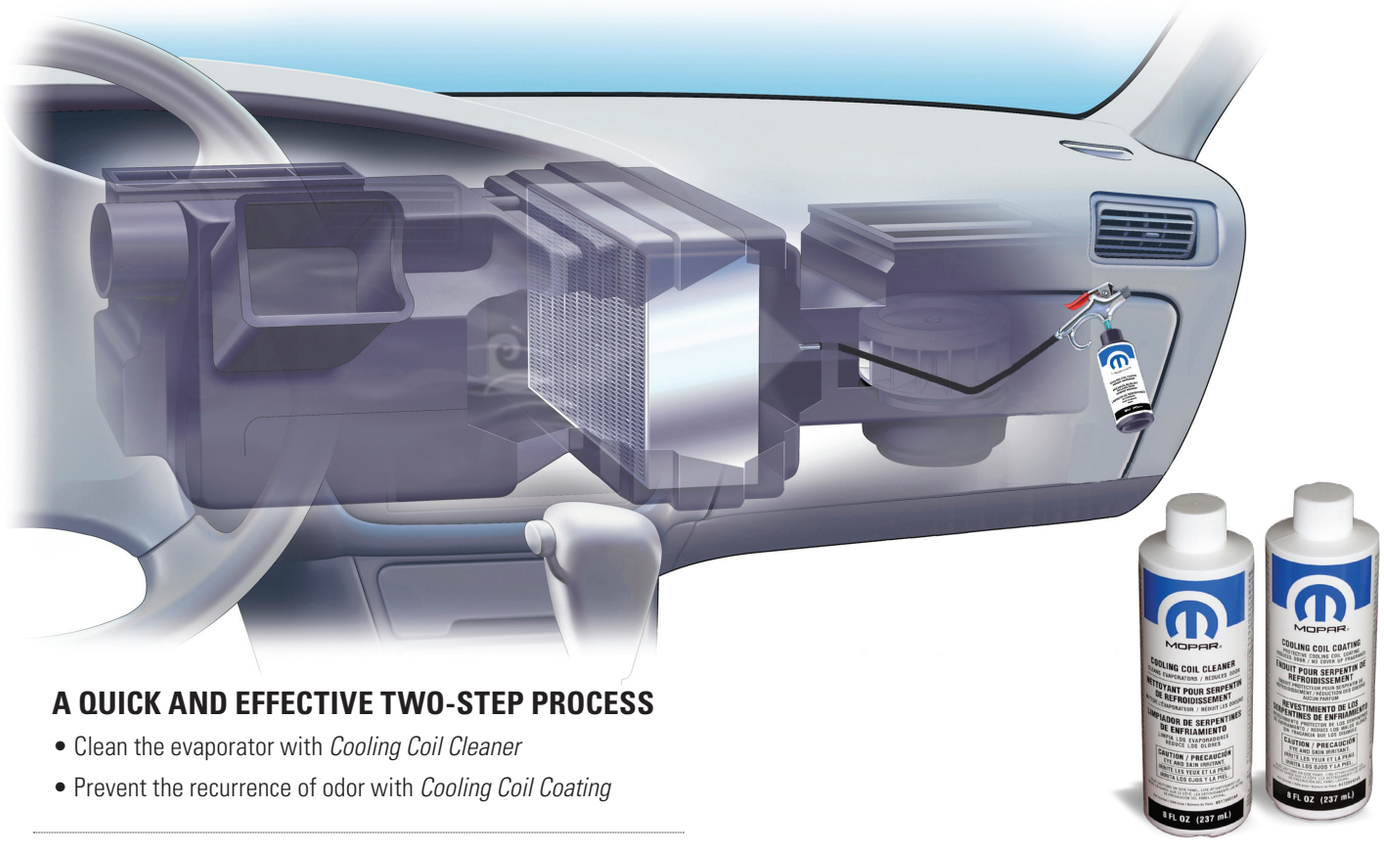

A QUICK AND EFFECTIVE TWO-STEP PROCESS

- Clean the evaporator with *Cooling Coil Cleaner*
- Prevent the recurrence of odor with *Cooling Coil Coating*

Approved by Chrysler LLC Engineering. Most vehicles can be treated in less than one hour. Single-use bottle packaging makes inventory management and billing easy. For application instructions, refer to Service Bulletin #24-013-05.

DESCRIPTION	PART NUMBER
COOLING COIL CLEANER	05170022AA
COOLING COIL COATING	04728942AB
ULTI-FLEX SPRAY TOOL*	534-62637

MOPAR COOLING COIL CLEANER & MOPAR COOLING COIL COATING — THE ONLY APPROVED A/C ODOR REMEDY!

**ULTI-Flex spray tool available from team PSE. Call 1.800.223.5623.*

12995_CoolingCoilFly.indd 1 2/12/08 7:38:40 AM

SERVICE BULLETIN

NUMBER: 24-013-05
GROUP: Heating & A/C
DATE: August 4, 2005

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

SUBJECT:
A/C Cooling Coil Odor

OVERVIEW:
This bulletin involves inspecting for leaves and other foreign material, cleaning, and treating the cooling coil and housing.

MODELS:

1995 - 2003	(AB)	Ram Van/Wagon
1995 - 2004	(AN)	Dakota
2004 - 2006	(CS)	Pacifica
1998 - 2003	(DN)	Durango
2002 - 2006	(DR/DH/D1)	Ram Pickup
2004 - 2006	(HB)	Durango
2001 - 2006	(JR)	Sebring Convertible/Sebring Sedan/Stratus Sedan
2002 - 2006	(KJ)	Liberty
1993 - 2004	(LH)	300M/Concorde/LHS/New Yorker/Intrepid/Vision
2005 - 2006	(LX)	300/Magnum
2005 - 2006	(ND)	Dakota
2002	(PG)	PT Cruiser (International Markets)
1995 - 2005	(PL)	Neon/SX 2.0
2001 - 2006	(PT)	PT Cruiser
2001 - 2006	(RG)	Chrysler Voyager (International Markets)
2001 - 2006	(RS)	Town & Country/Caravan/Voyager
2001 - 2005	(ST)	Sebring Coupe/Stratus Coupe
1997 - 2006	(TJ)	Wrangler
2002 - 2006	(VA)	Sprinter
1999 - 2004	(WJ/WG)	Grand Cherokee
2005 - 2006	(WK/WH)	Grand Cherokee
2006	(XK)	Commander

SYMPTOM/CONDITION:
Some vehicle operators may experience a musty odor from the A/C system, primarily at start up in hot and humid climates. This odor may be the result of microbial growth on the cooling coil. During normal A/C system operation, condensation forms in and around the A/C cooling coil. When airborne pollutants mix with this condensation, bacteria and fungi growth begins and odor results.

DIAGNOSIS:
If the operator describes, or the technician experiences a musty odor when operating the A/C system, perform the appropriate Repair Procedure based on the vehicle model.

PARTS REQUIRED:

Qty.	Part No.	Description
AR (3)	05170022AA	Cleaner, A/C Cooling Coil, 8 oz. Bottle Refer To Table For Quantity Required
1	04728942AB	Coating, A/C Cooling Coil, 8 oz. Bottle
AR (1)	82205905	Filter, Cabin Air (CS/RS vehicles)
AR (1)	04596501AB	Filter, Pollen (LX vehicles w/sales code ADB)
AR (1)	05103600AA	Filter, A/C and Heater Unit (VA vehicles)

Jeep SERVICE
Stick with the Specialists™

SEE FULL SERVICE BULLETIN FOR ADDITIONAL DETAILS.

12995 0108 © 2008, Chrysler LLC. All rights reserved. Chrysler, Jeep®, Dodge and Mopar® are registered trademarks of Chrysler LLC. Printed in U.S.A.